



Smart Top Link

**Smart Top Link software update and
diagnostics Manual**


Contents

Wind Tools installation.....	3
Software installation to ECU.....	5
A. Cloud:.....	5
B. Local.....	6
Most common issues	7


Wind Tools installation

Compatibility: Requires iOS 14.2 or later /Android 5.1 and up


1. Download and install “JCA Wind Tools” from your mobile device application store. You may also find it as “Wind Tools” by PTx Trimble

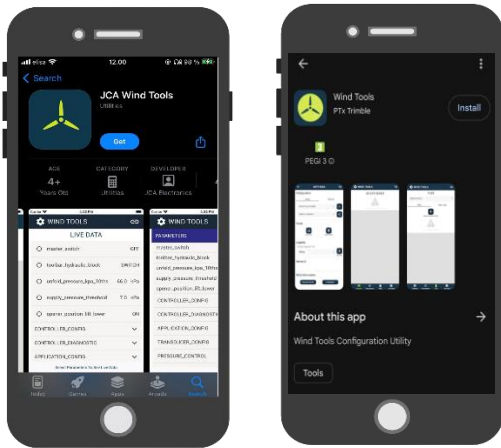


2. Once you have installed Wind Tools open the application and **select settings**

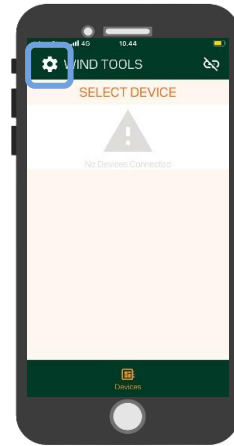


3. Select the + button next to “Select User Profile”

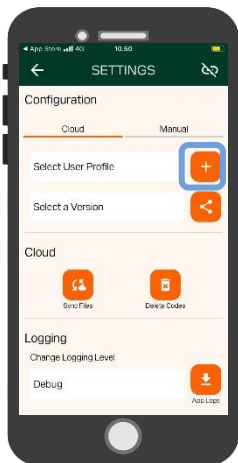


4. Enter the code “SmartTopLink-STLjs6GgP” (Pay attention to upper- and lower-case letters!) and select “OK”

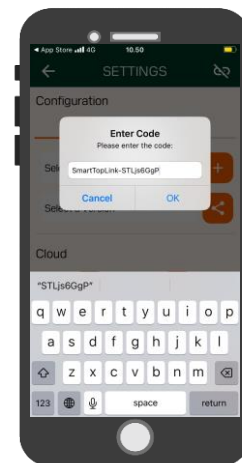


5. Press “**Select User Profile**” and then choose the “**SmartTopLink Falcon+ User**” and “**Done**”

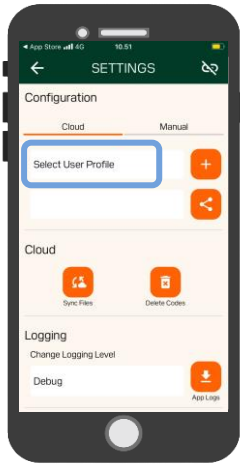


6. Press “**Select a Version**” and then **choose the latest software from the list**. Latest software has the highest numbers

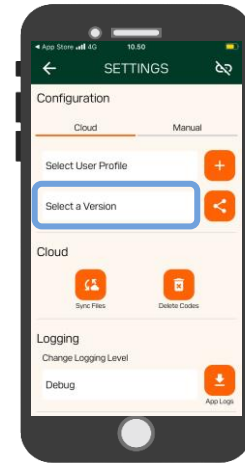

7. Go to your devices WiFi settings and **connect to “DepthSensorJCAxxx..”*** with the default password “12345678”

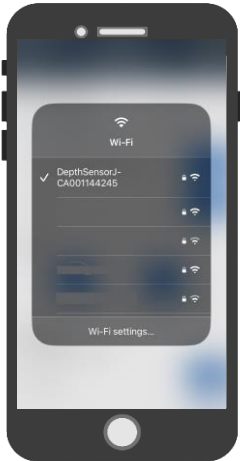

8. **Return to the Windtools app**. You should now see the connected icon in the top right

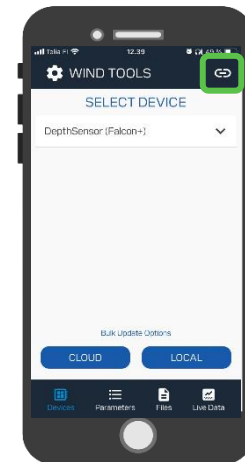

Software installation to ECU



The software can be updated in **one** of the following ways:

- A. Cloud (**recommended**) – updating all of the software directly from the internet with latest software available
- B. Local – updating all of the software using a .zip file saved on your device


A. Cloud (recommended):

1. On the main page, select “Cloud” and then select the correct software version

2. Select “Start”

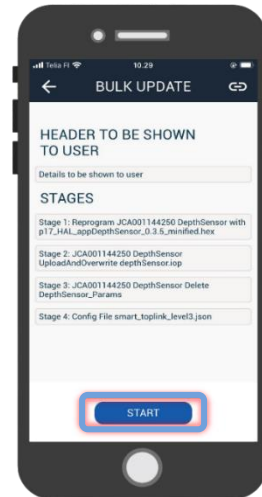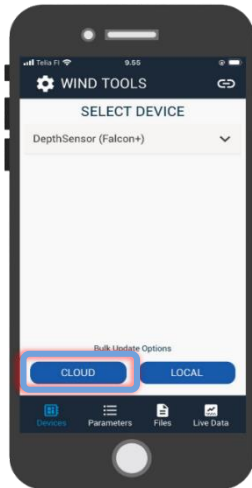


3. The application then executes the required stages and then restarts the system. **Software update is now complete**

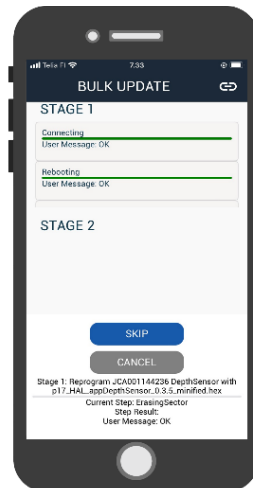


B. Local

1. Select “Local”

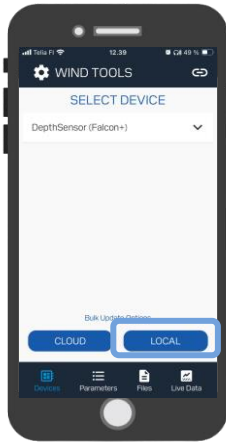

2. Select the correct .zip file from your device’s memory*

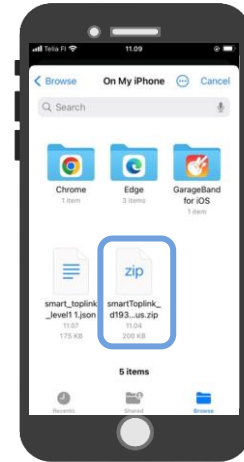


**This must be already saved to your device. You can download it from www.access.agcocorp.com*

3. Select “Start”



4. The application then executes the required stages and then restarts the system. **Software update is now complete**

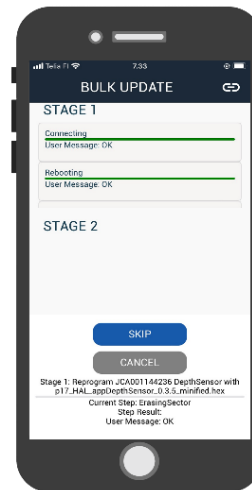

Most common issues

Issue: I can't find "DepthSensorJCAxxx." from the Wifi list

In some cases, the correct Wifi is called "**falcon_default**". After you update the software, the name will change to "**DepthSensorJCAxxx.**"



Issue: SW update failed

Usually with issues like "**Failed to execute bulk update**" and "**Config File Missing**", the software **update is successful**, but you get the error simply because some of the files are not updated. Just press OK on both and make sure that the latest software is updated to the system from Diagnostics view on the Smart Top Link

